


XR

UNDERCUTS



Patented

Max. 150°C

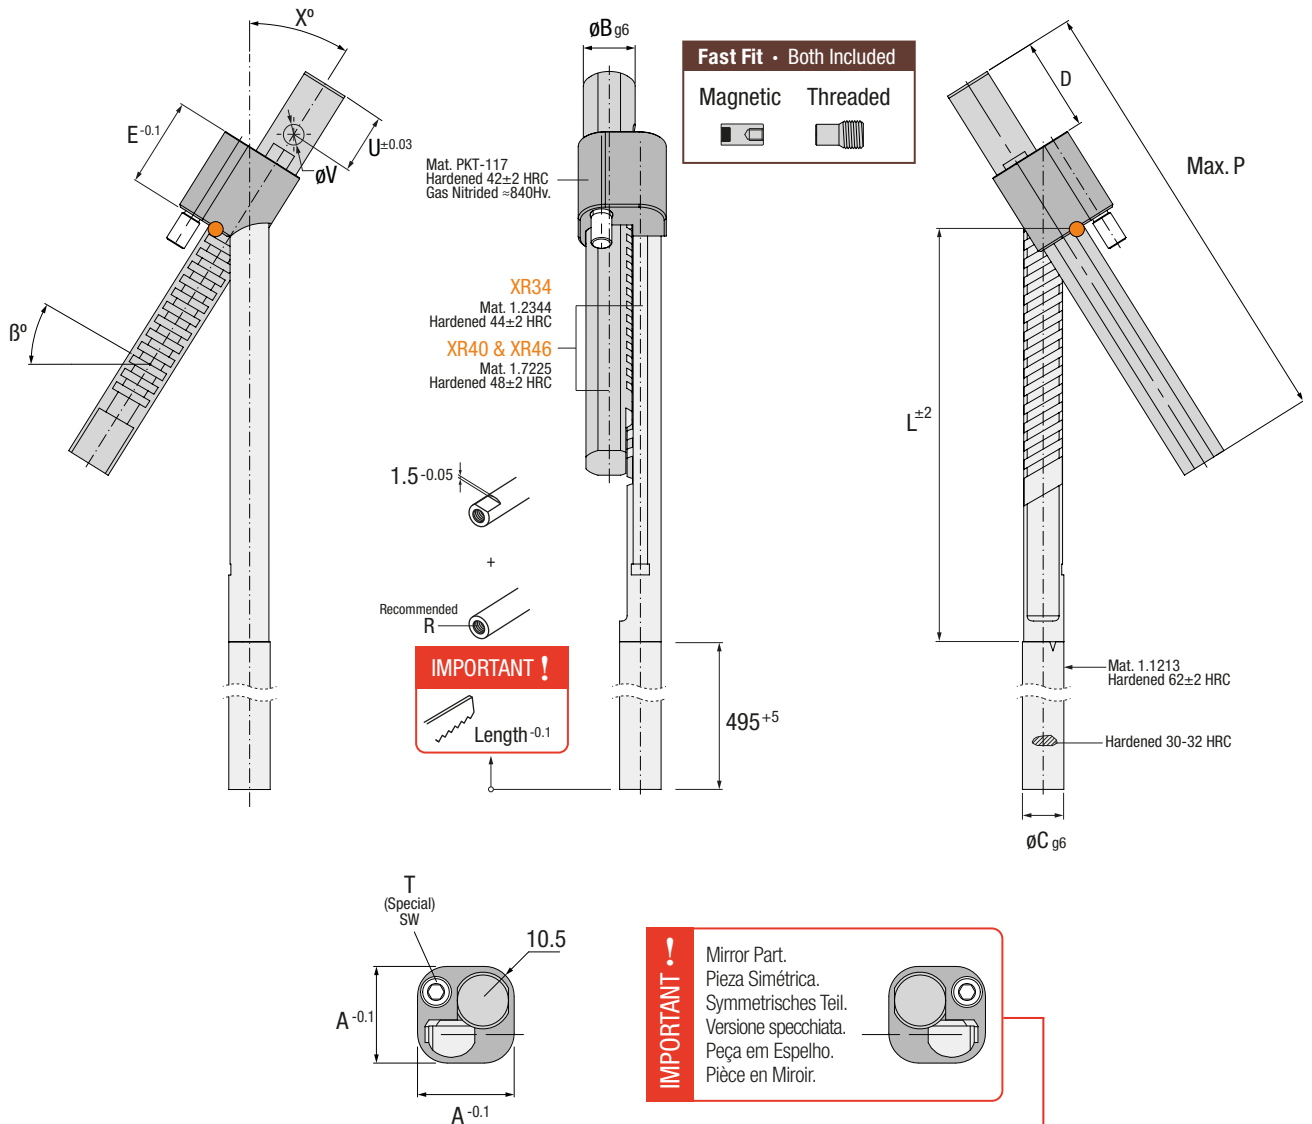

Ref.	X°				A	B	C	D	E	L	P	R	T	U	V	Mirror Ref. -S	Stroke	SWa
XR34100L-x	24	28	32	36	34	20	16	36	34	159	225	M8	M8	23	8	XR34100L-x-S	100	5
XR40100L-x	24	28	32	36	40	22	20	36	40	170	240	M10	M10	20	10	XR40100L-x-S	100	6
XR46100L-x	24	28	32	36	46	24	24	42	46	174	255	M10	M12	26	10	XR46100L-x-S	100	8



PLAY

! HOW TO ORDER

Check page 50-51 for Min / Max β values

$\beta^\circ < 0$ & $\beta^\circ = 0$ $\beta^\circ > 0$

A
Stroke
X°
 β
Standard
A
Stroke
X°
 β

XR 34 100L - 28 -10
XR 34 100L - 28 +10

A
Stroke
X°
 β
Symmetrical
A
Stroke
X°
 β



XR 34 100L - 28 -S -10
XR 34 100L - 28 -S +10

INSTALLATION GUIDELINES

ES Consejos de Instalación DE Richtlinien zur Installation
IT Consigli di Installazione PT Instruções de Instalação FR Mode d'Installation

Core Housing


Alojamiento Placa Punzón
Kerngehäuse
Sede nel Punzone
Alojamento Bucha
Logement dans l'empreinte

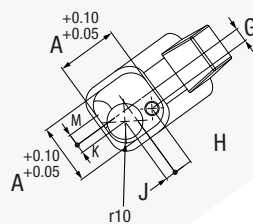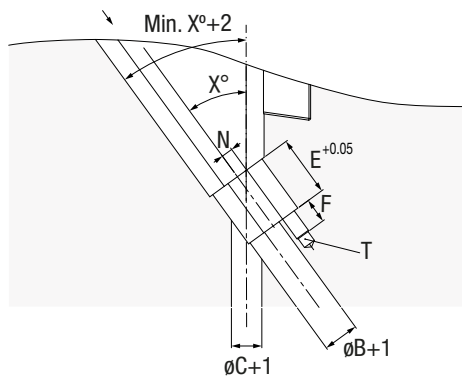

Stroke 100	F	FR1	FR2	G	H	J	K	M	N	S	T	W	Y	Z	SWb
XR34100L-..	16	5.3	MF 10x1	8	10.5	6	5	7	6	4	M8	8	16	M4	5
XR40100L-..	20	8.5	MF 12x1	11	11	7	7	8	7	4	M10	10	20	M6	6
XR46100L-..	25	8.5	MF 12x1	13	13	9	9	8	8	5	M12	10	24	M6	8

Installation

Instalación · Montage · Montaggio · Instalação · Montage

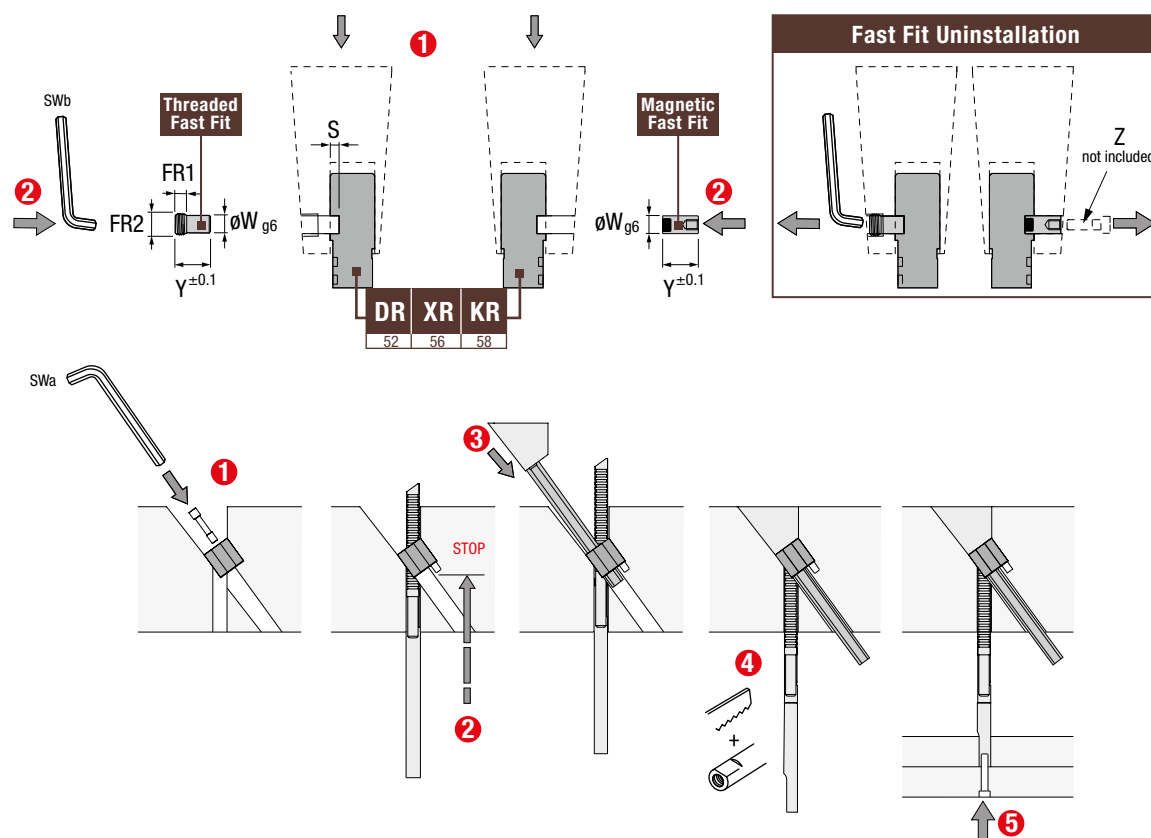

XR

UNDERCUTS



Patented

